

SAFETY RECALL NOTICE

EB2200i • EU2200i Portable Generators SHORT CIRCUIT

Check below to see if your generator is affected by this recall.



SERIAL NUMBER

Affected Model	Starting Serial Number	Ending Serial Number
EB2200i	EAJT-1000001	EAJT-1011342
EU2200i EU2200i Companion EU2200i Camo	EAMT-1000001	EAMT-2098790


Units previously repaired are no longer part of this recall.

They can be identified by one of the following:



A “yellow dot” located on the carton with a “7EV” marking.

A “7EV” label on the engine cover above the oil dipstick.

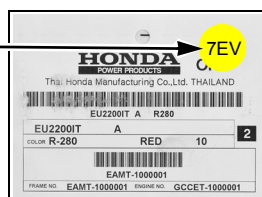

SKU#	SKU Description	Model #	Internet #	UPC
1003001030	2,200-Watt Gasoline Powered Portable Inverter Generator	EU2200i	304205470	786102006484
			305164329	786102006385
1004299973	Honda 2200W Inverter Generator	EU2200i	309137224	786102007207
			309140502	786102007283
1004225603	Honda 2200W Inverter Generator	EB2200i	309162368	786102007238

What is the problem?

In certain EB2200i and EU2200i generators operated under certain environmental conditions, water may enter into an electrical connection on the inverter (located behind the control panel) and cause a short circuit failure and/or fire. This concern predominantly occurs in applications or regions where salt water is present.

Symptoms of this concern are typically identified by the overload alarm flashing continuously, the smell of melting or burning plastic during or after operation, or the presence of smoke or fire.

What should you do?

If you own an EB2200i or EU2200i generator, you will need to check to see if the serial number is within the affected serial number range and has not been previously repaired. If it is within the affected range and has not been previously repaired, stop using your generator until it has been repaired by an authorized Honda dealer.

Also:

- If your generator was registered with American Honda and is affected, you will receive a letter.
- If your generator was not registered with American Honda, contact your Honda Power Equipment servicing dealer.

If you need assistance locating a servicing dealer, please visit our website: powerequipment.honda.com, or call us at our recall line (888) 888-3139, option 4.

This recall is being conducted in cooperation with the U.S. Consumer Product Safety Commission